
Xcel Energy South Control Center Daily Operations Report

Date: 2/13/2010

Out Time: In Time:
(Begin:) (End:)

| | | |
|--------------|--------------|---|
| 13:24 | 15:42 | Blackhawk Interchange Low gas alarm on bkr 1H80. Notified DCC for Sube Worked TWR to add SF6 gas, alarm cleared |
| 15:21 | 15:42 | Blackhawk Interchange - TWR on Bkr 1H80 added SF6 gas. |
| 17:05 | 17:20 | Carriers tested OK |
| 20:14 | 4:05 | Spearman Interchange - Station bkr low operating pressure alarm. Called out sube. Sube found failed compressor on bkr 1H16. Compressor replaced and alarm cleared at 4:50 on 2/14/10 |
| 21:35 | 23:05 | Perryton Interchange - Station low operating pressure alarm. Called out sube. Informed sube that N. 115/12.5 KV TF low Nitrogen alarm also. Sube reported pressure good on bkr 1H55 @ 140lbs |
| 23:53 | 1:13 | Perryton Interchange - Scada indicated LOP notified DDC for sube. After discussion with sube, opened bkr 1H55 @ 0113h, with 1H55 open bkrs 1H60 will reclose for ckt V92 and 1H65 will reclose for ckt T2. Sube will check for possible leaking Ross valve on bkr 1H55on Monday. |